

Work Order ID 56822



Page 1

March 10, 2010 2:46:12 PM

Item ID: D412-664-203TRN

Accept



Setup Start



Revision ID:

Item Name: Crosstube Turning Detail

Stop



Start Date: 10/03/2010 Start Qty: 1.00



Cust Item ID:

Required Date: 25/03/2010 Req'd Qty: 1.00



Customer:

Reference:

Approvals:

Process Plan:

PL

Date: 10-3-10

Tooling:

Date:

Run Start



QC:

Date:

SPC (Y/N):

Date:

Stop



Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Draw Number	Draw Rev.	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
Draw Nbr	Revision Nbr								
D412-664-243	Rev E								

100



Mori Seiki

Mori Seiki CNC Lathe Large

MORI SEIKI CNC LATHE LARGE

0.00

Memo

0.00

1-Fill tube with sand & install plugs DT8534 on both ends as per Folio FA166
2-Turn first side as per Folio FA166
3- File transition lines smooth.

(IX)

MB/AWM 10-03-16

110



QC

Quality Control

QC1- Inspect dimensions to dimension sheet

0.00

Memo

0.00

(IX)

MB/AWM 10-03-16

120



Mori Seiki

Mori Seiki CNC Lathe Large

MORI SEIKI CNC LATHE LARGE

0.00

Memo

0.00

1-Turn second side as per Folio FA166
2- File transition lines smooth.
3- Remove sand and plugs
4-Scribe part # and batch # using vibrating stilus

(IX)

MB/AWM 10-03-16

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 56822

March 10, 2010 2:46:12 PM



Page 2

Item ID: D412-664-203TRN

Accept



Setup Start



Revision ID:

Item Name: Crosstube Turning Detail

Stop



Start Date: 10/03/2010 Start Qty: 1.00



Cust Item ID:

Required Date: 25/03/2010 Req'd Qty: 1.00



Customer:

Reference:

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run Start



QC:

Date:

SPC (Y/N):

Date:

Stop

Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run HoursDraw
NumberDraw
Rev.Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

130

QC1- Inspect dimensions to dimension sheet

0.00



QC

Memo

0.00

Quality Control

(14) ~~Q~~ MB ~~AWM~~ 10-3-10

140

QC8- Inspect parts - second check

0.00



QC

Memo

0.00

Quality Control

S 10/03/10



150

Crosstubes Chemical Conversion

0.00



HandFXtube

Memo

0.00

Hand Finishing Crosstubes

DP 10-3-10

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 56822

March 10, 2010 2:46:12 PM



Page 3

Item ID: D412-664-203TRN

Accept



Setup Start



Revision ID:

Item Name: Crosstube Turning Detail

Stop



Start Date: 10/03/2010 Start Qty: 1.00



Cust Item ID:

Required Date: 25/03/2010 Req'd Qty: 1.00

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Run Start



Stop



Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Draw Number	Draw Rev.	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	----------------	--------------	--------------	---------------	---------------	------------------	----------------

160

QC3- Inspect Part Finish

0.00



QC

Memo

0.00

Quality Control

1 M 10/3/18

170

Packaging

0.00



Packaging

Memo

0.00

Packaging

Identify and stock in kanban rack
Location: E61

1 M 10/3/18

180

QC21- Final Inspection - Work Order Release

0.00



QC

Memo

0.00

Quality Control

10/03/24 JF

MF 10-3-18

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

March 10, 2010 2:46:19 PM

Page 1

Work Order ID: 56822



Parent Item: D412-664-203TRN



Parent Item Name: Crosstube Turning Detail

Start Date: 10/03/2010

Required Date: 25/03/2010

Comments: IPP Rev:A 08-03-06 new issue DD verified by:eec
IPP Rev B 08.04.02 Removed polish EC verified by: DD

Start Qty: 1.00

Required Qty: 1.00

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Remaining Qty To Pick	Qty Issued	Date Issued	Status
D6009-129		Manufactured	No			120	Each	30.0000	1.0000			



Crosstube Material



Warehouse

Loc Qty

Loc Code

Location

Main Warehouse

LG

30

38342

14

53594

16

AWM 10-3-16

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

DART AEROSPACE LTD		Work Order:	54922
Description: Crosstube Assembly (412 High Aft)		Part Number:	D412-664-243
Inspection Dwg: D412-664-243 Rev: E		Page 1 of 1	

FIRST ARTICLE INSPECTION CHECKLIST

☒ First Article ☐ Prototype

Inspection Sheet Drawing Dimension	Tolerance	Actual Dimension	Accept	Reject	Method of Inspection	Comments
SIDE A	2.684	+0.005/-0.000	2.685 ✓			
	2.748	+0.005/-0.000	2.751 ✓			
	2.884	+0.005/-0.000	2.898 ✓			
	3.019	+0.005/-0.000	3.023 ✓			
	3.163	+0.005/-0.000	3.166 ✓			
	3.308	+0.005/-0.000	3.312 ✓			
	3.429	+0.005/-0.000	3.430 ✓			
	2.990	+0.005/-0.000	2.990 ✓			
	2.618	+0.005/-0.000	2.618 ✓			
	0.200	+/-0.010	0.201 ✓			
	R0.063	+/-0.010	R0.063 ✓			
	R0.500	+/-0.010	R0.500 ✓			
	4.971	+/-0.030	4.972 ✓			
SIDE B	2.684	+0.005/-0.000	2.686 L			
	2.748	+0.005/-0.000	2.750 L			
	2.884	+0.005/-0.000	2.886 L			
	3.019	+0.005/-0.000	3.023 L			
	3.163	+0.005/-0.000	3.165 L			
	3.308	+0.005/-0.000	3.311 L			
	3.429	+0.005/-0.000	3.431 L			
	2.990	+0.005/-0.000	2.990 L			
	2.618	+0.005/-0.000	2.620 L			
	0.200	+/-0.010	0.201 L			
	R0.063	+/-0.010	R0.063 L			
	R0.500	+/-0.010	R0.500 L			
	4.971	+/-0.030	4.972 L			
	124.100	+/-0.020	124.100 L			

Measured by:	AWN / MS
Date:	10-03-16

Audited by:	S
Date:	10/03/16

Prototype Approval:	N/A
Date:	N/A

Rev	Date	Change	Revised by	Approved
A	04.06.16	New Issue (P/O D412-664-203)	KJ/JLM	
B	06.03.09	Dwg Rev updated	KJ/JLM	
C	07.05.08	Tolerance updated for dimension 4.971	KJ/JLM	
D	10.02.02	Dimension 124.100 was 124.09	KJ	

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Item	Qty -243	Part Number	Description
1	X	D412-664-243	CROSSTUBE ASSEMBLY (412 HIGH AFT)
2	1	D6009-129	CROSSTUBE
3	2	D3595-063-570	RUBBER CUSHION
4	1	D2896-1	SUPPORT
5	2	D3189-1	CHAFING SHIELD
6	2	D2856-600-1009	ABRASION STRIP
7	4	MS21920-28	CLAMP
8	2	MS21920-30	CLAMP (OR MS21920-32)
9	A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947-100, TYPE II, CLASS 2 ADHESIVE)

GENERAL NOTES:

- 1) MATERIAL: MANUFACTURED FROM D6009-129
FINISHED LENGTH = 124.100±0.020 (BEFORE BENDING/TRIMMING)
- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART QSI 005 4.2
- 3) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED.
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- 6) IDENTIFICATION: SCRIBE DART PART NUMBER "D412-664-243" AND BATCH NUMBER ON INSIDE OF CUFF USING VIBRATING STYLUS.
- 7) WEIGHT: 47.0 lbs (PER IIN-D212-664)
- 8) PART IS SYMMETRIC ABOUT CENTERLINE.
- 9) RUN CUTTER OFF PART. BLEND OUT EDGE LONGITUDINALLY. TRANSITION SHOULD BE SMOOTH.
- 10) BEND PROGRESSIVELY WITH A MINIMUM OF 8 PASSES. MAXIMUM TUBE FLATTENING DUE TO BENDING IS 6% BASED ON O.D.
- 11) LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.
- 12) INSTALL D2896-1 SUPPORT USING 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 TO THE SURFACE OF D2896-1 THAT WILL BE IN CONTACT WITH THE CROSSTUBE PER QSI 015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 13) INSTALL MS21920-30 CLAMPS (OR -32) WITH D3595-063-570 RUBBER CUSHIONS TO SECURE THE D2896-1 SUPPORT ON TOP SIDE OF THE CROSSTUBE. ENSURE CLAMPS ARE OPPOSITE OF CROSSTUBE SUPPORT.
- 14) INSTALL D2856-600-1009 ABRASION STRIPS WITH A 0.13 REF GAP ON BOTTOM SIDE OF CROSSTUBE PER QSI 035.
- 15) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.
- 16) TORQUE CLAMPS 80 TO 100 IN.-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 56822

B810-3-10

RELEASED
2009-10-29

E	REFORMAT/REVISE GENERAL NOTES; REORGANIZED VIEWS AND REFORMATTED DRAWING TO CURRENT STANDARDS; RELOCATED FLAG #6 PER PAR 08-046 (ZN A6-3); ADD TOLERANCE (ZN B6-3, C4-3, C8-3 & C5-3); MOVED TURNING DETAIL & UPDATED TOLERANCE TO SHEET 4.	RF	09.09.30
D	REMOVE D2732-058, CHANGE TO D3595-063-570	PH	07.03.09
C	REMOVE D2856-600-1087, ADD D2732-058 & MAGNOBOND 6398, MS21920-32 WAS MS21920-30	MB	06.10.27
B	ADD HOLES FOR COMPATABILITY WITH BHT/AA SKIDTUBES	PH	05.02.04
A	NEW ISSUE	PH	01.10.17
REV.	DESCRIPTION	BY	DATE
DESIGN	PH	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	RF		
CHECKED	PH	DRAWING NO.	REV. E
MFG. APPR.	PH	D412-664-243	SHEET 1 OF 4
APPROVED	PH	TITLE	SCALE
DE APPR.	PH	CROSSTUBE ASSEMBLY (412 HI AFT)	NTS
DATE	09.09.30	<small>COPYRIGHT © 2001 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL. UNLESS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE REPRODUCED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small>	


W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____


Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			


NOTE: Date & initial all entries

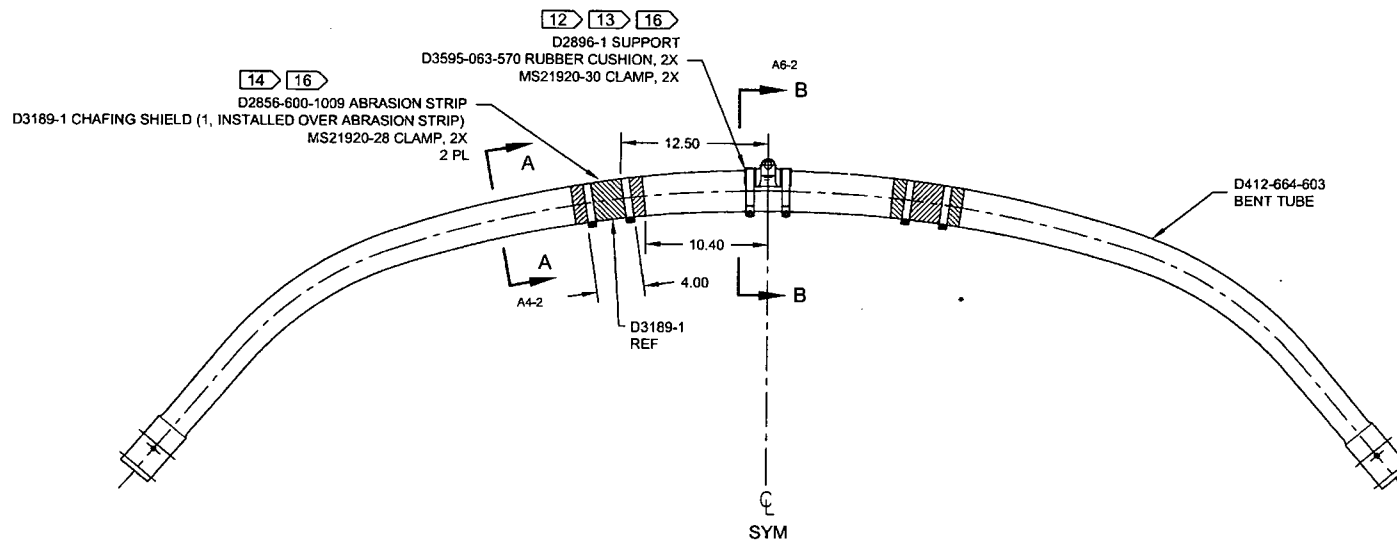

D212-664-243
ASSEMBLY DETAIL

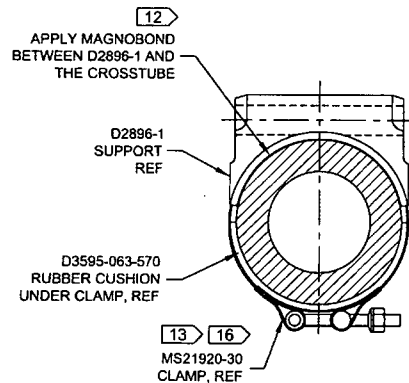

SECTION B-B D4-2
SCALE 4X

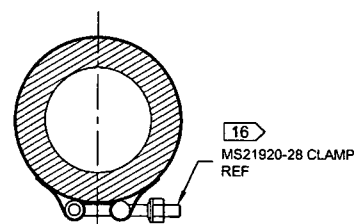

SECTION A-A C6-2
SCALE 4X

RELEASED
2009-10-28
NRP

DESIGN	PH	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	Q	DRAWING NO.	REV. E
MFG. APPR.	JS	D412-664-243	SHEET 2 OF 4
APPROVED	JP	TITLE	SCALE
DE APPR.	JP	CROSSTUBE ASSEMBLY (412 HI AFT)	NTS
DATE	09.09.30	<small>COPYRIGHT © 2001 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSES OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small>	

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector




Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

D412-664-603 10
BENDING AND DRILLING DETAIL E

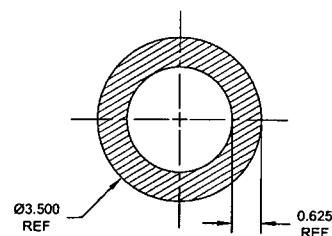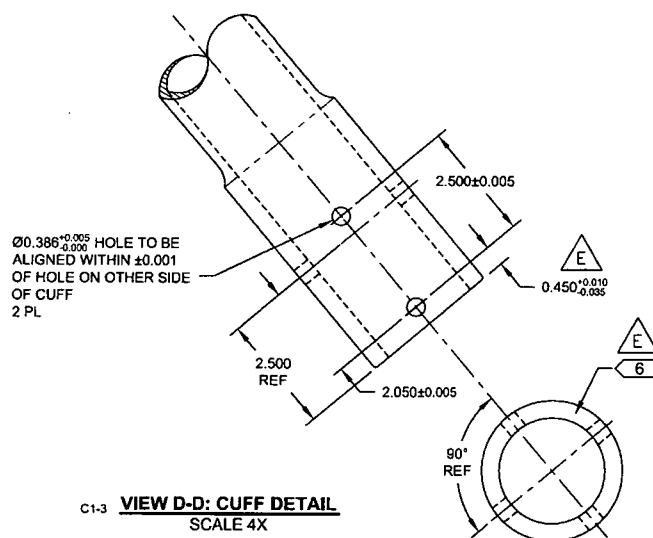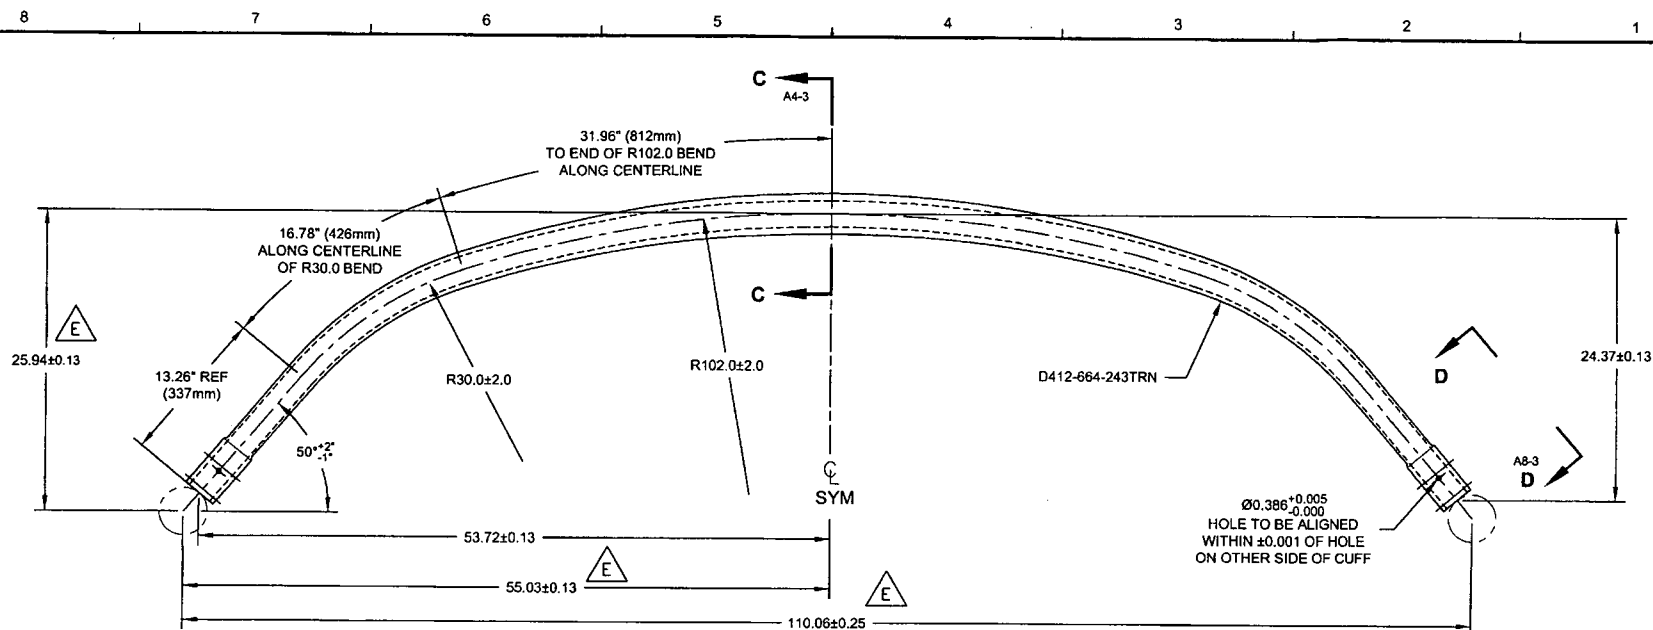

RELEASED
 2009-10-29

DESIGN	PH	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	92	DRAWING NO. D412-664-243	REV. E
MFG. APPR.	DS		SHEET 3 OF 4
APPROVED	10	TITLE	SCALE
DE APPR.	4	CROSSTUBE ASSEMBLY (412 HI AFT)	NTS
DATE	09.09.30	COPYRIGHT © 2001 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	


W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

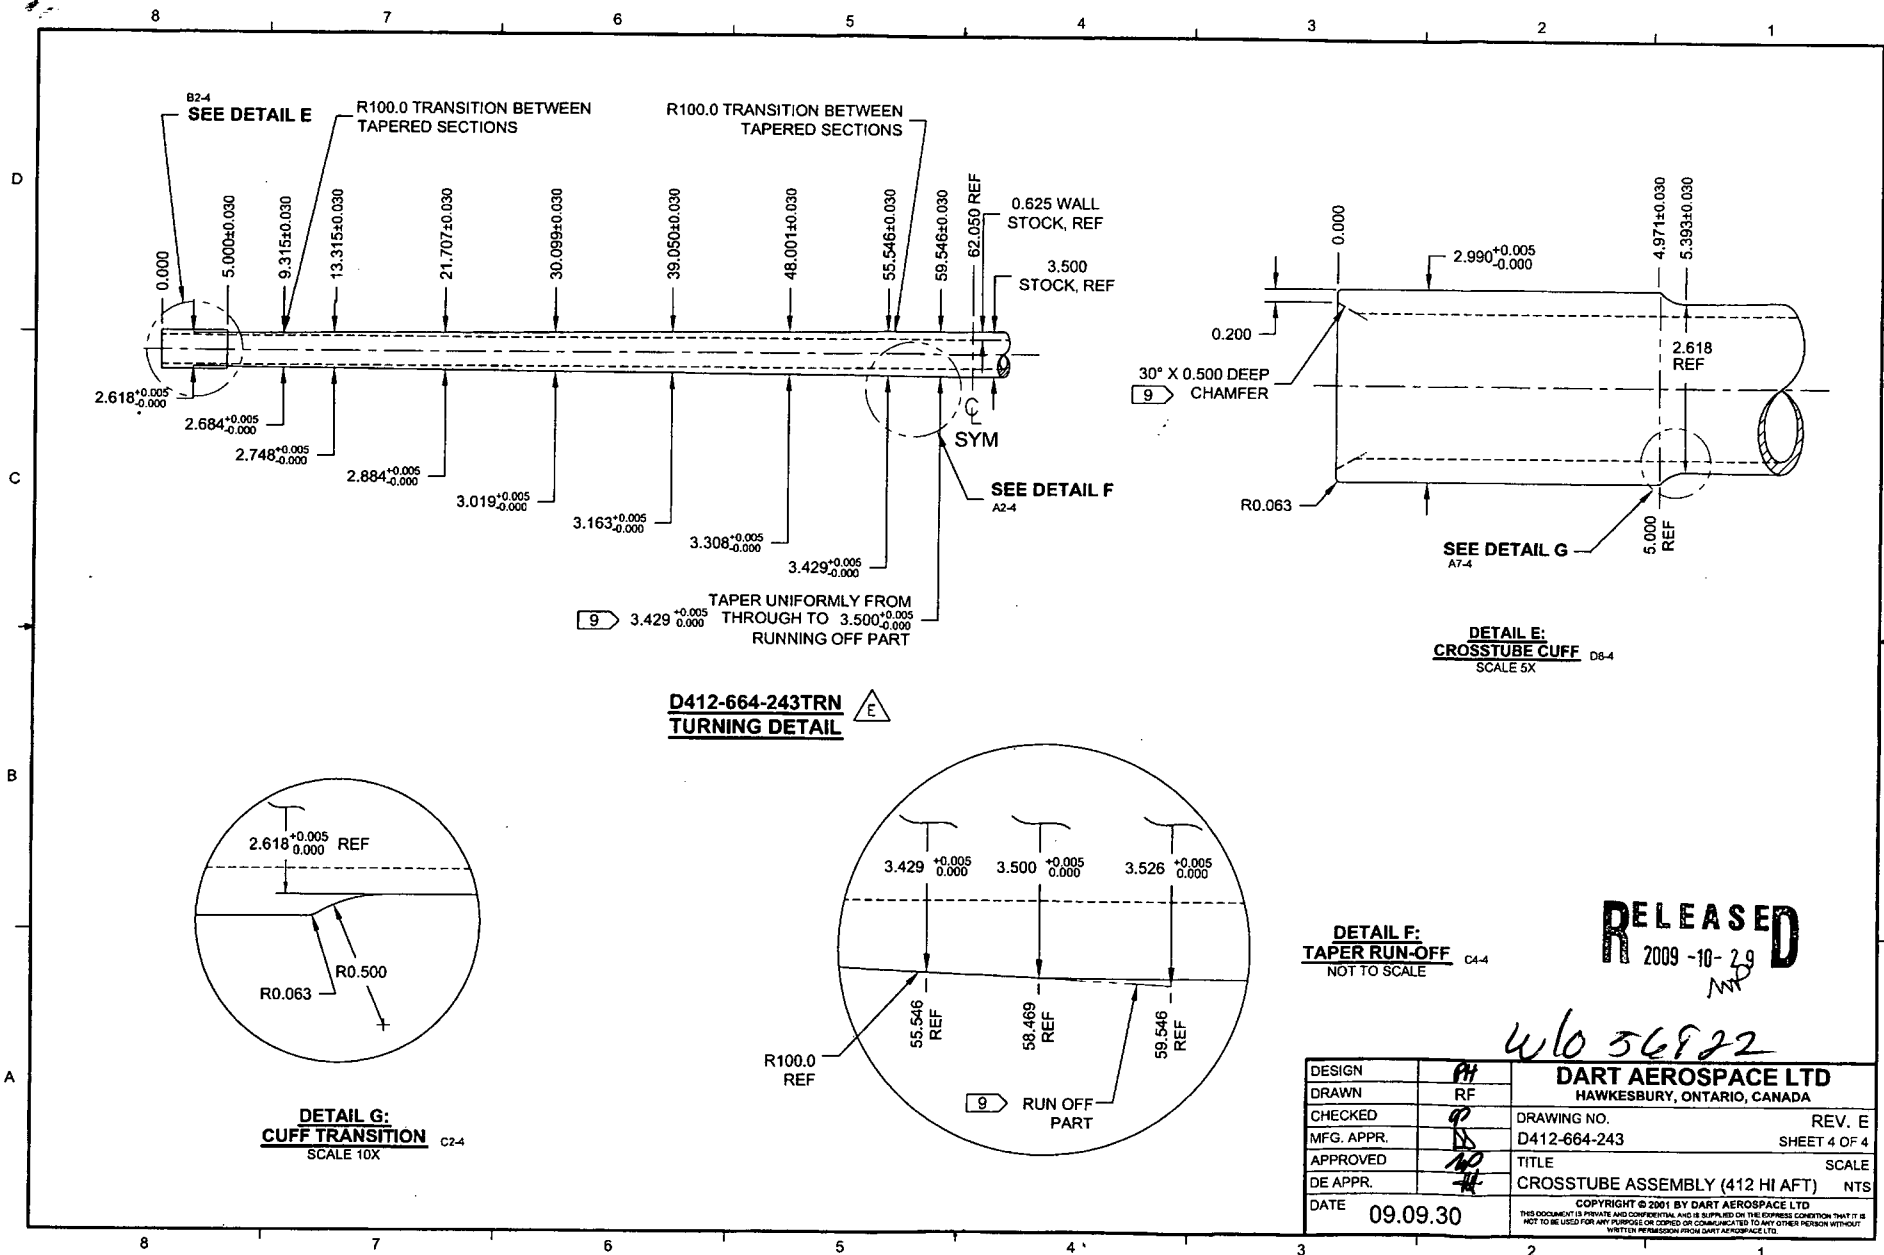

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries